PRODUCT INFORMATION LEWATIT[®] UltraPure 1294 MD




For the production of ultra-high-purity water (> 18 MOhm*cm at 25 °C) as non-regenerable mixed bed.


Lewatit[®] **UltraPure 1294 MD** is a ready-to-use mixed bed comprising gelular strongly acidic cation (SAC) and strongly basic (type I) anion (SBA) exchange resin. Both components are highly regenerated and specially cleaned in order to meet the specifications for highly purified water such as minimum TOC release, low ion leaching and high operating capacity.

The mixture is adjusted corresponding to the total capacity of the individual components to an equivalent ratio of 1:1.

The extremely high monodispersity (uniformity coefficient: 1.1) and the very low content of fines (< 0.315 mm: max. 0.1 %) results in particulary low pressure losses compared to standard resins.

The special properties of this product can only be fully utilized if the technology and process used correspond to the current state-of-the -art. Further advice in this matter can be obtained from Lanxess, Business Unit Ion Exchange Resins.

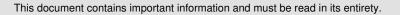

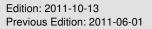



PRODUCT INFORMATION LEWATIT[®] UltraPure 1294 MD



General Description

| - | |
|-----------------------|---------------------------|
| Ionic form as shipped | H⁺/OH⁻ |
| Functional group | sulfonic acid/quat. amine |
| Matrix | crosslinked polystyrene |
| Structure | gel type beads |
| Appearance | brown, translucent |

Physical and Chemical Properties

| | | metric units | | | | |
|-------------------------|-------------------------|-----------------|-------------------------|----|----|----|
| Uniformity Coefficient* | | max. | SB | | | .1 |
| | | | SAG | C: | 1 | .1 |
| Mean bead size* | | mm | SBA: | | | |
| | | 0.60 (+/- 0.07) | | | | |
| | | | SAC: | | | |
| | | | 0.60 (+/- 0.05) | | 5) | |
| Bulk density | (+/- 5 %) | g/l | 750 | | | |
| Water retention* | | wt. % | SBA: | 55 | - | 65 |
| | | | SAC: | 45 | - | 55 |
| Total capacity* | Total capacity* min. eq | | SBA OH ⁻ 1.1 | | | .1 |
| | | | SAC H⁺ 2.1 | | | |
| Mixing ratio* | | vol. % | SBA: | 58 | - | 62 |
| | | | SAC: | 38 | - | 42 |
| Volume change | H⁺/OH⁻>Ca, Mg/Cl, SO₄ | max. vol. % | - 15 | | | |
| Storability | of the product | max. months | 3 | | | |
| Storability | temperature range | ĉ | -20 - 40 | | | |
| TOC release*(a. 80 BV) | | max. ppb | | 1. | .5 | |
| Resistivity effluent* | after 20 BV | MOhm*cm | 18.2 (+/- 0,05) | | | |

* Specification values subjected to continuous monitoring.

This document contains important information and must be read in its entirety.





Recommended Operating Conditions*


| | | metric units | |
|------------------------|------------|------------------------------|--------|
| Operating temperature | | max. ℃ | 40 |
| Operating pH-range | | | 0 - 14 |
| Bed depth | | min. mm | 600 |
| Specific pressure drop | (15 °C) | approx. kPa*h/m ² | 1.5 |
| Pressure drop | | max. kPa | 150 |
| Specific flow rate | exhaustion | max. BV/h | 8 - 48 |

* The recommended operating conditions refer to the use of the product under normal operating conditions. It is based on tests in pilot plants and data obtained from industrial applications. However, additional data are needed to calculate the resin volumes required for ion exchange units. These data are to be found in our Technical Information Sheets.

This document contains important information and must be read in its entirety.



PRODUCT INFORMATION LEWATIT[®] UltraPure 1294 MD

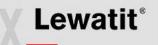

Additional Information & Regulations

Safety precautions

Strong oxidants, e.g. nitric acid, can cause violent reactions if they come into contact with ion exchange resins.

Toxicity

The safety data sheet must be observed. It contains additional data on product description, transport, storage, handling, safety and ecology.

Disposal

In the European Community Ion exchange resins have to be disposed, according to the European waste nomenclature which can be accessed on the internet-site of the European Union.

Storage

It is recommended to store ion exchange resins at temperatures above the freezing point of water under roof in dry conditions without exposure to direct sunlight. If resin should become frozen, it should not be mechanically handled and left to thaw out gradually at ambient temperature. It must be completely thawed before handling or use. No attempt should be made to accelerate the thawing process.

This information and our technical advice – whether verbal, in writing or by way of trials – are given in good faith but without warranty, and this also applies where proprietary rights of third parties are involved. Our advice does not release you from the obligation to check its validity and to test our products as to their suitability for the intended processes and uses. The application, use and processing of our products and the products manufactured by you on the basis of our technical advice are beyond our control and, therefore, entirely your own responsibility. Our products are sold in accordance with the current version of our General Conditions of Sale and Delivery.



info@lenntech.com www.lenntech.com Tel. +31-15-261.09.00 Fax. +31-15-261.62.89

This document contains important information and must be read in its entirety.

